

LCD Display



When LCD display shows a load weight press "P" key to get barcode label with load weight information

ED3-Zebra SkidWeigh Plus

Turn on ignition switch on

The LCD display will show date / time.

Wait until Bluetooth icon is shown on LCD display. System is ready to operate.




Insert the forks into the pallet or product to be weighed

- Lower the loaded forks to the ground.
- With LCD showing date/time, lift load **just above the ground**
- Do not manipulate the tilt, side shifter or move vehicle
- LCD display will show "PLEASE WAIT".
- Within few seconds load weight will be indicated on LCD display.
If you press "P key" the barcode ticket will be provided on Zebra printer

**Note: LCD display must show date / time to initiate weighing cycle!
Loaded forks must be on the ground!**



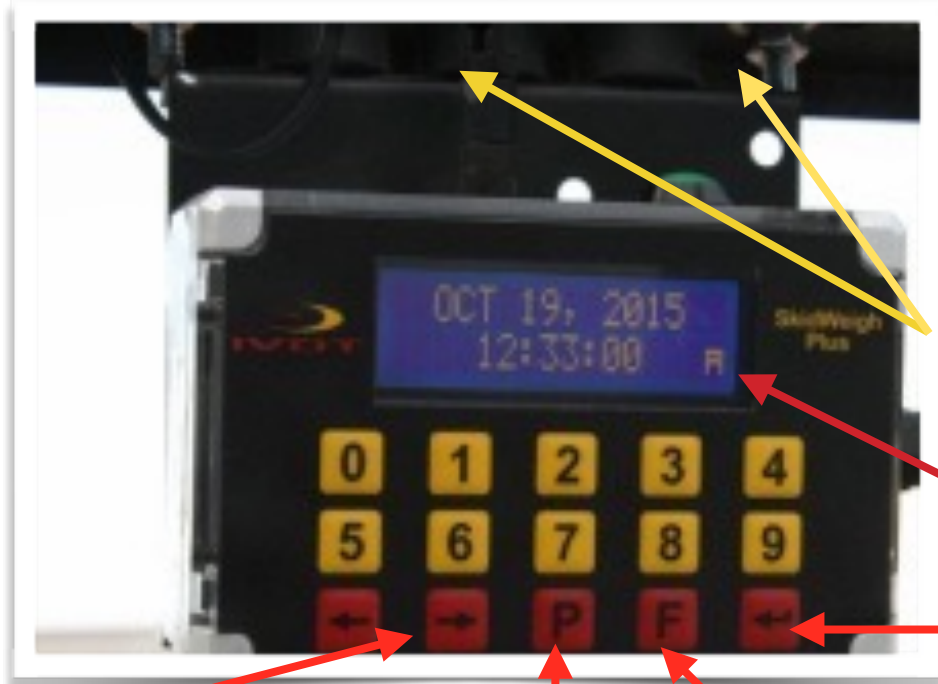

Mounting brackets with vibration mounts

Bluetooth Icon

“Enter key”

Scroll keys

Function key

With LCD showing load weight press “P” key and barcode label with data will be provided

No. ID-R3AT5F
350 Labels
Size: 3” x 1.75”



Latch Release Button For Media Load

